
rev. 00 - 14/10/22

Remote control for PICO WI / WI-C / WI-C-CO²

CDE00008 - CDE00009 - CDE00010



USING THE REMOTE CONTROL

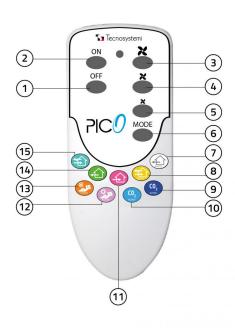

- [1] Fan OFF
- [2] Fan ON
- [3] Maximum speed (humidity value 60%)
- [4] Medium speed (humidity value 50%)
- [5] Low speed (humidity value 40%)
- [6] Change mode
- [7] AUTO 2
- [8] AUTO 1
- [9] AUTO 6
- [10] AUTO 5
- [11] Delivery
- [12] AUTO 4 Winter comfort mode
- [13] AUTO 3 Summer comfort mode
- [14] Extraction
- [15] Air recovery unit

FUNCTIONS OF THE REMOTE CONTROL

HEAT RECOVERY UNIT: the system works for 70 seconds in intake and for 70 seconds in delivery with the possibility to regulate the three speeds.

EXTRACTION: the system works in internal air extraction only mode, with the possibility to regulate the three speeds.

DELIVERY: the device works in aeration only mode, aspirating external air and introducing it into the room, the possibility of regulating the three speeds is provided.

AUTO 1: the system is in standby, when the air in the room exceeds the threshold of humidity; settable at 40%, 50% or 60%, the device starts in recovery mode until the humidity level falls within the set value.

AUTO 2: the system is in standby, when the air in the room exceeds the threshold of humidity; settable at 40%, 50% or 60%, the device starts in extraction only mode until the humidity level falls within the set value.

AUTO 3 - SUMMER COMFORT: the system is in stand-by mode, if the outdoor temperature is lower than the indoor temperature, the heat recovery unit will go into delivery mode at maximum speed; the machine will return to standby when the temperature value is restored.

AUTO 4 - WINTER COMFORT: the system is in stand-by mode, if the outdoor temperature is higher than the indoor temperature, the heat recovery unit will go into delivery mode at maximum speed; the machine will return to standby when the temperature value is restored.

AUTO 5: the system is in stand-by mode, when the threshold of CO₂ (800 ppmv) is exceeded, the heat recovery unit will go into recovery mode at maximum speed, the machine will return to stand-by when the value of CO₂ is restored.

AUTO 6: the system is in standby, when the threshold of CO_2 (800 ppmv) is exceeded, the heat recovery unit will go into extraction mode at full speed, the machine will return to standby when the value of CO_2 is restored.

ITEMS

| CODE | DESCRIPTION |
|----------|----------------------------------|
| CDE00008 | REMOTE CONTROL FOR PICO WI |
| CDE00009 | REMOTE CONTROL FOR PICO WI-C |
| CDE00010 | REMOTE CONTROL FOR PICO WI-C-CO2 |